DMS No.: 3203157, V01 **Page:** 1 of 10

URGENT FIELD SAFETY NOTICE

Subject: 656504: HLS/ HIT Set - potentially compromised sterile barrier

Affected Product:

REF no.	Article no.	Product description
BE-HLS 7050	701069073	HLS Set Advanced 7.0 with BIOLINE Coating, for the NONUS market
BE-HLS 5050	701069076	HLS Set Advanced 5.0 with BIOLINE Coating, for the NONUS market
BO-HLS 7050	701069083	HLS Set Advanced 7.0 with SOFLINE Coating, for the CA market

Affected Batch No.: See Annex I List of affected batches included below

Unique Device Identifier:


REF no.	Article no.	UDI
BE-HLS 7050	701069073	04058863005744
BE-HLS 5050	701069076	04058863078298
BO-HLS 7050	701069083	04058863020082

Dear valued customer,

The HLS Set Advanced is intended for use in an extracorporeal circulation for cardiac support and/ or pulmonary support.

Maquet Cardiopulmonary GmbH (MCP) has received customer complaints of damage to the primary packaging of the HLS Set Advanced. In all customer complaints it was reported that the Tyvek cover was damaged. The appearance of the packaging failure can be hole(s) in the Tyvek. The damages are caused by the tabs of the venous probe holder within the packaging. Consequently, holes can appear on the left side of the Tyvek (pictures 1 and 2), which corresponds to the position of the venous probe holder.



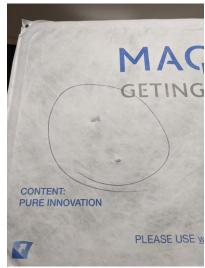

Pictures 1 and 2 holes

FIELD SAFETY NOTICE



DMS No.: 3203157, V01 **Page:** 2 of 10

The results of the product packaging investigation suggest that the Tyvek damage only occurs, if the HLS Set drops with the topside facing down so that either the velcro straps, which hold the HLS Modules, come loose or the HLS Module detaches. A shift/ movement of the HLS Module affords the opportunity for the venous probe tab(s) to perforate the Tyvek cover and the sterile barrier system may be compromised.

Exposure to a non-sterile or potentially non-sterile medical device, or a delay in the procedure, may result in following immediate and/ or long-range health consequences:

- Inflammation,
- Infection,
- Sepsis,
- Ischemia

Maquet Cardiopulmonary GmbH has not received any reports of adverse events due to damage to the sterile barrier system of the HLS Set.

Maquet Cardiopulmonary GmbH is working with urgency on the packaging design change in order to reduce the shift/ movement of the HLS Module. However, it takes time to perform such change based on all regulatory requirements. Therefore, we can provide to you at this time only devices with the same packaging design as possible replacement. The only changes in devices with old packaging design will be a better controlled transport condition against drops with the topside facing down and that all HLS Sets will have additional affixed "Inspection Instruction" on the white box. The affixed "Inspection Instruction" on the white box will help you to have a better traceability of the current packaging design. As soon as we have finalized the new packaging design change and have produced first lots, we will inform you about the first lot number.

Please take care that you check all devices which you have in your stock today and devices which you can receive soon, provided your national competent authority allows this, based on the provided instructions, see option 2 in chapter "Action to be taken" below.

DMS No.: 3203157, V01 **Page:** 3 of 10

Action to be taken: Due to a potential delay of replacement products:

Option 1


- Please return immediately all affected products in your stock to your local Getinge representative.
- In case of return of the affected products, please contact your local Getinge representative for credit or replacement.
- If a product is already in use, it should remain in use.

Option 2:

- If the products are necessary based on expert clinical judgement, you can use the devices after following these inspection measures:
 - Prior to use, the HLS Sets Tray covers have to be checked visually for any damages, holes or tears in order to prevent the use of an unsterile medical device.
 - 2. After removing the tray from the secondary package (white cardboard box), position the tray in a well-lit area outside the sterile field.
 - Check the integrity of the sterile barrier of the tray (Tyvek cover) before
 use. If any doubt arises as to package integrity, then it should not be
 used. Any product with damaged packaging must be returned to the
 local Getinge representative.





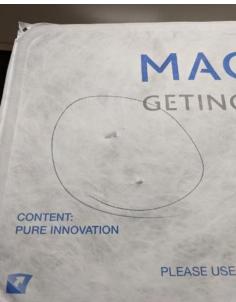

Picture 4: Typical appearance of damage

 <u>Please note</u>, that all products which you can receive at this time contains old packaging design and they have affixed "Inspection instruction" on the white box. **DMS No.:** 3203157, V01 **Page:** 4 of 10

 Regardless of the decision you make, please complete and sign the attached customer response form and send it back to your local Getinge representative.

 Please report any adverse events in regards to the affected products to your Getinge Representative.

Enclosed documents:

- 656504 customer response form
- Annex I List of affected batches

Transmission of the Field Safety Notice:

- This notice needs to be forwarded to all those who need to be aware within your organization or to any organization where the potentially affected devices may have been further distributed.
- Please maintain awareness of the notice and resulting actions for an appropriate period to ensure effectiveness of the corrective action.

We apologize for any inconvenience caused and assure you that we are working with highest priority on a solution. As required, we will provide this notification to the necessary Regulatory Agencies.

Should you have questions or require additional information, please contact your local Getinge representative. Sincerely.

Managing Director

Signature: Dieter Engel Electronically signed by: Dieter Engel Reason: I approve this document. Date: Jul 14, 2022 17:29 GMT+2

Email: dieter.engel@getinge.com

Person Responsible for Regulatory Compliance (PRRC)

Signature: Timur Güvercinci

Electronically signed by: Timur Güvercinci Reason: I approve this document. Date: Jul 14, 2022 17:20 GMT+2

Email: timur.guevercinci@getinge.com

Maquet Cardiopulmonary GmbH Kehler Str. 31 76437 Rastatt GERMANY

Phone: +49 7222 932 - 0 Email: FSCA.cp@getinge.com **DMS No.:** 3203157, V01 **Page:** 5 of 10

CUSTOMER RESPONSE FORM

Subject: 656504: HLS/ HIT Set - potentially compromised sterile barrier

Affected Product:

REF no.	Article no.	Product description
BE-HLS 7050	701069073	HLS Set Advanced 7.0 with BIOLINE Coating, for the NONUS market
BE-HLS 5050	701069076	HLS Set Advanced 5.0 with BIOLINE Coating, for the NONUS market
BO-HLS 7050	701069083	HLS Set Advanced 7.0 with SOFLINE Coating, for the CA market

Affected Batch No.: See Annex I List of affected batches included below

I have read and understand this Field Safety Notice for above mentioned affected products. We will take ion as soon as possible according to given instructions.
I confirm that I have distributed this Field Safety Notice to the affected personal.
All affected products have been consumed.
Following affected products in our inventory will be inspected and if a sterile barrier is compromised, we return the product/s to you for credit/ replacement.
Following affected products will be returned to you for credit/ replacement.

REF	Article Number	Description	Batch Number	Quantity

Your Comments:

FIELD SAFETY NOTICE

DMS No.: 3203157, V01



Country	Hospital / Clinic (full address)
Date	Name (Function)
	Signature

Please return the completed form to your local Getinge representative by email enter local Getinge mail address or via post enter local Getinge address or FAX>:

DMS No.: 3203157, V01 **Page:** 7 of 10

Annex I List of affected batches

This Annex I List of affected batches is considered as a supplementary attachment to the 656504 Field Safety Notice.

Below are listed all batches of products which are affected and have been distributed.

Table 1 general overview

REF	Article	Batch range
BE-HLS 7050	701069073	from 3000182107 to 3000234524
BE-HLS 5050	701069076	from 3000189274 to 3000227602
BO-HLS 7050	701069083	from 3000190163 to 3000192093

Table 2 all affected lots per country

Country	Article No.	Product Description	Batch
·			from 3000187932
Argentina	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000222885
			from 3000182110
Australia	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000234524
Australia	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	3000189718
			from 3000182112
Austria	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220053
	70400000	DO 111 0 7050 #0/ 111 T 0 / A 1	from 3000190163
Austria	701069083	BO-HLS 7050 #S/ HIT Set Advanced 7.0	to 3000192093
Belarus	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	3000208673
			from 3000182111
Belgium	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220052
Bosnia-			from 3000182111
Herzegovina	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000199088
D "	704000070	DE 111 0 7050 #0111 0 0 4 A 1 17 0	from 3000189184
Brazil	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000217603
Brazil	701060076	BE-HLS 5050 #SHLS Set Advanced 5.0	from 3000220058 to 3000222886
Brunei	701009070	BE-FILS 5050 #SFILS Set Advanced 5.0	from 3000190527
Darussal	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000218622
Darabbar	701000070	DE FILE FOOD WELLES COLFRAVALIONA FILE	from 3000207493
Chile	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220051
			from 3000205877
China	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000228851
			from 3000199095
China	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000227602
Colombia	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	3000208678
			from 3000222886
Colombia	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000223281
			from 3000182107
Costa Rica	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000207493
			from 3000182117
Croatia	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000217600

DMS No.: 3203157, V01 **Page:** 8 of 10

Country	Article No.	Product Description	Batch
, , , , ,			from 3000190531
Cyprus	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000217596
- 71			from 3000182110
Czech Republic	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220053
			from 3000215235
Czech Republic	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000223281
Czech Republic	701069083	BO-HLS 7050 #S/ HIT Set Advanced 7.0	3000190163
•			from 3000190526
Denmark	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220051
			from 3000193372
Denmark	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000199095
			from 3000189186
Egypt	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000190526
			from 3000189187
Estonia	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000215329
			from 3000182110
Finland	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220052
			from 3000182107
France	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220052
			from 3000189274
France	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000227601
			from 3000182107
Germany	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220053
			from 3000189274
Germany	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000227600
			from 3000190163
Germany	701069083	BO-HLS 7050 #S/ HIT Set Advanced 7.0	to 3000192093
			from 3000182114
Greece	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000216178
			from 3000187932
Hong Kong	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000222885
			from 3000189190
Hungary	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000217593
l			from 3000189188
Iceland	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000217596
	70400070		from 3000220058
Iceland	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000223281
1	70400070	DE 111 0 7050 #0111 0 0 11 A 1 2 2 2 1 7 0	from 3000190531
India	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000225894
laste a d	704000070	DE 111 0 7050 #0111 0 0 ct Advance d 7 0	from 3000182108
Ireland	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220051
lorgol	701060070	DE ULS 7050 #SULS Set Advanced 7.0	from 3000182110
Israel	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000216191
Italy	701060073	RE HI S 7050 #SHI S Set Advenced 7.0	from 3000182107 to 3000220053
ltalı.	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	from 3000189274
Italy	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000223281
	701009076	DE-FILO 5050 #SFILO SEL AUVAITCEU 5.0	from 3000182115
Japan	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000227590
σαραιτ	701003073	DE FILO 7000 #OFILO OCT AUVAITCEU 7.0	from 3000182110
Jordan	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000196202
Kosovo	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	3000193371 -

DMS No.: 3203157, V01 **Page:** 9 of 10

Country	Article No.	Product Description	Batch
-		·	from 3000182107
Kuwait	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000232542
Kuwait	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	3000215235 -
			from 3000195593
Latvia	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000205876
Lebanon	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	from 3000223280
			from 3000182110
Lithuania	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000208670
Luxembourg	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	from 3000187933 to 3000217600
Macedonia	701069073		3000217592
Malaysia	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	3000193367
Mayiga	701060073	DE LILE 7050 #SULS Set Advanced 7.0	from 3000182118
Mexico	701069073		to 3000217596
Nepal	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	3000190534 from 3000183107
Netherlands	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	from 3000182107 to 3000220053
Netherlands	701003073	BE-1123 7030 #31123 Set Advanced 7.0	from 3000189718
Netherianas	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000223281
Netherlands	701069083		3000192093
	70100000	Do File Food Way Tim Got Advanced File	from 3000187932
New Zealand	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000227573
			from 3000182114
Norway	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220051
Namusi	704000070	DE 111 C 5050 #0111 C Cat Advanced 5 0	from 3000193372
Norway	701069076		to 3000220050
Oman	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	3000223280 from 3000187932
Pakistan	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000216193
Panama	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	3000207497
Panama			
	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	3000215235 from 3000182108
Philippines	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000207489
Poland	701003070	DE TIES 7000 WOTTES SECTRAVAILORGY 7.0	from 3000182107
i olalia	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000218626
Poland	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	3000193372
Poland	701069083	BO-HLS 7050 #S/ HIT Set Advanced 7.0	3000192093
Portugal	70100000	Do Filed Food Way Tim Cott/tavarious 7.0	from 3000182110
i o cagai	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220052
Portugal			from 3000189274
	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000227601
Qatar	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	3000207507
Romania			from 3000182118
	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000218616
Romania	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	from 3000193372 to 3000223281
Russian	701009076	DE-TIES 5050 #SITES SEL AUVAITCEU 5.0	
Federation	701060073	RE ULS 7050 #SULS Set Advenced 7.0	from 3000190528
Saudi Arabia	701069073		to 3000199081
Sauui Aldbid	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	from 3000182117

FIELD SAFETY NOTICE



DMS No.: 3203157, V01 **Page:** 10 of 10

Country	Article No.	Product Description	Batch
J G Gill III y			to 3000232542
Saudi Arabia			from 3000189718
	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000223281
Serbia			from 3000182111
	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000217600
Singapore			from 3000182116
	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000218622
Slovakia			from 3000192085
	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000210637
Slovenia			from 3000182115
	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000212854
South Africa	70400070	DE 111 0 7050 #0111 0 0 4 A 1	from 3000187933
	701069073		to 3000217597
South Africa	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	300022005
South Korea			from 3000187932
	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000232542
Spain			from 3000182107
	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220053
Spain			from 3000189274
	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000227600
Sweden	704000070	DE 111 0 7050 #0111 0 0 th Advance d 7 0	from 3000182107
6 ''	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220053 from 3000189188
Switzerland	701069073	DE ULS 7050 #SULS Set Advanced 7.0	
Curitana alamad	701009073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000220052 from 3000190163
Switzerland	701069083	BO-HLS 7050 #S/ HIT Set Advanced 7.0	to 3000192093
Thailand	701003003	De lies 1030 #6/ Till Get Advanced 1.0	from 3000195070
Tilalialiu	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000218617
Turkey	101000010		from 3000182110
rancy	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000218617
United Arab			from 3000190527
Emirates	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000232542
United Arab	701000070	DE FILE FOOD WOFFLED COLFACIONOCA F.O	10 00002020 12
Emirates	701069076	DE ULS FOED #SULS Set Advanced F.O.	2000222284
	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	3000223281
United			from 3000182107
Kingdom	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000218622
United			from 3000189718
Kingdom	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	to 3000220058
Vietnam			from 3000182115
	701069073	BE-HLS 7050 #SHLS Set Advanced 7.0	to 3000212850
Vietnam	701069076	BE-HLS 5050 #SHLS Set Advanced 5.0	3000215235